

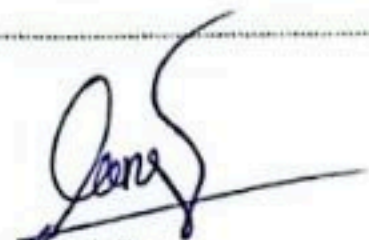
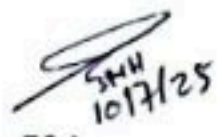
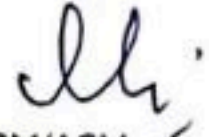
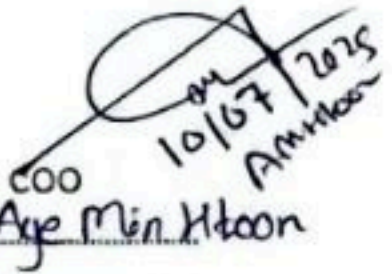
## CLAIM REQUEST FORM

Requestor Name : Phyu Phyu Win(5)	Budget Type : Include Budget
Department Name:	Payment Type : Claim Payment
Request Date : 2025-07-08	Prepared By : CE1_BudgetDataEntry
Payment Voucher : EX-CE1-2025-07-00003	Superior Approved : CE1_ServiceDH
No	By
Payment Method : Cash/Bank	Last Approved By : CE1_ServiceDH
Payment Amount : 187500.0	
Currency : MMK	
Exchange Rate : 4,510.0	

No.	Description	Department	Request Amount	Remark
1	For TA charges for NPT branch support job. Customer - Daw Mar Mar Thein (EC290BLCL#18696), Problem - Injector failure	Service(CE1)	187,500.00	

Expense Total                      187,500.00 K  
Additional/Refund

Note: .....

<p style="text-align: center;"></p> <p>Superior Check By</p> <p>Name : <u>Aung Ka Min</u></p> <p>NRC No : .....</p> <p>Date : .....</p> <p>Remark : .....</p>	<p style="text-align: center;"> SMH 10/17/25</p> <p>F&amp;A</p> <p>Name : <u>Saw Nyan Hlaing</u></p> <p>NRC No : .....</p> <p>Date : .....</p> <p>Remark : .....</p>	<p style="text-align: center;"></p> <p>GM/AGM</p> <p>Name : <u>Min Thu Ya</u></p> <p>NRC No : .....</p> <p>Date : .....</p> <p>Remark : .....</p>	<p style="text-align: center;"> COO 10/16/2025 Aye Min Htoon</p> <p>COO</p> <p>Name : <u>Aye Min Htoon</u></p> <p>NRC No : .....</p> <p>Date : .....</p> <p>Remark : .....</p>
--	---	--	---

  
Phyu Phyu Win





# TRAVELLING REPORT

Date : ...28...6...2025....

Report To	Min Thu Ya, Zaw Min Myat	
Employee Name	Aung Ko Min	
Position	D.H	
Department	Service	
Business	CE-1 BU	
Departure & Arrival	Departure Date And Time	Arrival Date And Time
	12.6.2025 (9:00PM)	24.6.2025 (11:00PM)
Total Days	12.5 days	
Trip Information	1. From .....YANGON.....To .....NPT.....	
	2. From .....NPT.....To .....YANU.....	
	3. From .....To .....	
Purpose For Travelling	For branch support job (NPT). Customer - Daw Plar Plar Thein (CE29081C # 18696), Problem - Injector failure	
Travel Date	Activities	Remark
12.6.2025 13.6.2025 to 14.6.2025	Go to the NPT from Yangon. We go to the job site. We check fuel conditions, fuel system cleaning. We changed the new extra water separator, water separator and fuel filter. And then, we check electrical system. We changed new injectors and test run. All functions are normal. We found an exhaust muffler, hand pump, start motor are damaged. Need to change to a new one.	

Reported by  
 Sign :   
 Name : Aung Ko Min  
 Position :

Checked by  
 Sign :   
 Name : Min Thu Ya  
 Position :

Approved by  
 Sign :   
 Name : Aung Hsein Win  
 Position :  
 10/6/2025  
 AM/1000

(DH/AGM/GM)

(COO)

Date	Activities	Remark
15.6.2025	We disassembly swing motor and swing gearbox. We found swing motor cylinder blocks and valve plate are abnormal.	
16.6.2025	We assembly swing gear box and swing motor. And then we install swing and machine test run. But we operate the machine Engine RPM drop. So, we checked air system. We found a turbo outlet hose are damaged. And then, the start motor are abnormal.	
17.6.2025	We install the start motor and turbo outlet hose. And then, test run the machine. But not ok. Machine RPM are drop about (1900RPM). So, we need to check boost sensor and main pump regulator.	
18.6.2025	We changed new engine wire hardness and adjusted regulator. Test run the machine about 30mins. Engine suddenly stopped. Need to continue.	
19.6.2025	We check the safety solenoid wiring system. We found many wires are broken. So, we repaired this wireharness.	
20.6.2025	Test run the machine about 6 hours. We found many grease leakage from swing ring gear and under swing device.	
21.6.2025	We clean the swing grease and changed new grease and center joint cover seal.	
22.6.2025 to	Test run the machine and we <u>adjusted the main relief valve.</u>	
23.6.2025		
24.6.2025	And then come back to Yangon.	