
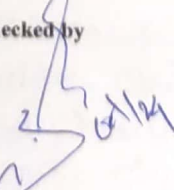



TRAVELLING REPORT

Date : 9.10.2024

Report To		
Employee Name	Hein Triha Soe, Nyi Min Khant	
Position	DH, Mechanic	
Department	Service	
Business	CNC BU	
Departure & Arrival	Departure Date And Time	Arrival Date And Time
		10.9.24 to 2.10.24
Total Days	23 days	
Trip Information	1. From YAN To Dawei	
	2. From Dawei To Yangon	
	3. From To	
Purpose For Travelling	Dawei, Kom Pakk Trip for Customer- PTTEP, Machine Model-A400, A600 Crane Repair and Troubleshooting	
Travel Date	Activities	Remark
10.09.2024	- Go to Dawei Arrived time (1:00 Pm) Join the meeting about safety and work with PTTEP team.	
11.09.2024	- A600 Visual checked the machine. Performance test the machine (no load). Checked the boom, swing, and telescop pressure test.	

Reported by
 Sign : 
 Name : Nyi Min Khant
 Position : Mechanic

Checked by
 Sign : 
 Name : Hei Triha Soe
 Position :
 (DH/AGM/GM)

Approved by
 Sign : 
 Name : Hei Triha Soe
 Position :
 (COO)

05-CHL-HRM-FRM-064-01

Date	Activities	Remark
1-2024	<p>(A600 Winch brake system * abnormal)</p> <ul style="list-style-type: none"> - Disassembled the winch motor and winch brake. Checked the new winch brake. Mounted the winch brake and winch motor. Test the winch brake function. It was ok and finished. 	pass
13.09.2024	<p>(A600 Front outrigger extraction cylinder (L) resealing) *</p> <ul style="list-style-type: none"> - Disassembling the extraction cylinder. Disassembly the extraction cylinder. Cleaning the cylinder rod, housing, piston and head. Checked the cylinder seal kit. Assembly the extraction cylinder. Mounting the extraction cylinder. Test the cylinder. It was ok. Job was finished. 	pass
14.09.2024	<p>(A600 Rear outrigger extraction cylinder (L) resealing) *</p> <ul style="list-style-type: none"> - Disassembling the extraction cylinder (L). Disassembly the extraction cylinder. Cleaning the cylinder rod, housing, piston and head. Checked the cylinder seal kit and parts. Assembly the extraction cylinder. Mounting the extraction cylinder. Test the cylinder. 	pass
	It was ok and finished.	

	Activities	Remark
2024	<p>(A600 Front audrigger extraction cylinder (R) oil leakage) *</p> <ul style="list-style-type: none"> - Disamounting the extraction cylinder. Disassembly the extraction cylinder. Cleaning the cylinder rod, housing, piston and head. Checked the cylinder sealkit and parts. Assembly the extraction cylinder. Mounting the extraction cylinder. Test the cylinder function. It was ok and finished. 	✓ pass.
16.09.2024	<p>(A600 Rear audrigger extraction cylinder (R) oil leakage) *</p> <ul style="list-style-type: none"> - Disamounting the extraction cylinder (R). Disassembly the extraction cylinder. Cleaning the cylinder rod, housing, piston and head. Checked the cylinder sealkit and parts. Assembly the extraction cylinder. Mounting the extraction cylinder. Test the cylinder function. It was ok and finished. 	✓ pass.
17.09.2024	<p>(A600 Hook block damage) *</p> <ul style="list-style-type: none"> - Disamounted the hook block. Disassembly the hook block. cleaning the ball bearing. Checking the ball bearing. It was ok and finished. 	

	Activities	Remark
18.09.2024	(A600 Hook block cleaning and repair) - Cleaning the ^{new} pulley and ball bearing. Assembly the hook block. Mounting the hook block. It was ok. Job was finished.	
19.09.2024	(A600 Boom and telescope holding valve function abnormal) - Boom and telescope holding valve is tested for pressure before being installed on the machine. Disassembling the boom and telescope (2) holding valve. Mounting the boom and telescope (2) holding valve. Test run the boom and telescope function with load. It was ok. Job was finished.	✓ pass.
20.09.2024	(A600 Final load test) - 10 ton of audrigger on each side. I put it on ^{for} about 15 minuts and tried it. Tested the boom pressure, telescope pressure, winch pressure and swing pressure. Test the boom function with load. It was ok. Job was finished.	✓ pass.

Date	Activities	Remark
11.09.2024	<p>(A 400 Winch motor, main hook and wire rope dismounted).</p> <p>- We visual checked the machine. Dismounted the wire rope, winch motor, winch and main hook. Disassembly the main hook and winch. Checked the 'S' parts. Cleaning the hook ball</p>	
22.09.2024	<p>(A 400 Winch brake changing; and mounting wire rope and main hook)</p> <p>- Mounting the winch, ^{new} brake and winch motor. Test the winch. It was ok. Mounting the main hook and wire rope. Test the machine. It was ok. Job was finished.</p>	<p>pass.</p>
23.09.2024	<p>(A 400 resealing and rigger extraction cylinder front and Rear L)</p> <p>- Dismounting the and rigger extraction cylinder. Disassembly the extraction cylinder. Cleaning the cylinder rod, piston, head and housing. Checked the seal kit and parts. Assembly the extraction cylinder. And then, Mounting the extraction cylinder. Test the machine and checked the oil leakage. It was ok. Job was finished.</p>	<p>pass.</p>

Date	Activites	Remark
1.09.2024	(A400 Mounting the audrigger extraction cylinder front and Rear L) - Mounting the audrigger extraction cylinder front and Rear L. Test the machine and checked the oil leakage. (finished)	
25.09.2024	(A400 Resealing the audrigger extraction cylinder front and Rear R) - Disamunted the extraction cylinder front and Rear R. Disassembly the extraction cylinder front and Rear R. Cleaning the cylinder rod, piston, head and housing. Checked the seal kit and parts. Assembly the extraction cylinder. (finished)	
26.09.2024	(A400 Mounting the audrigger extraction cylinder front and Rear R) - Mounting the audrigger extraction cylinder front and rear R. Test the machine and checked the oil leakage. (finished)	in pair. (for four cylinders)

Date	Activites	Remark
27.09.2024	(A 400 Swing function test) * - Swing pressure test (no load). Test the swing brake function with load. It was ok. And then, Every 90° of the machine is measured by the swing gear clearance. It was ok.	*
28.09.2024	(A 400 Auldigger test run with load) - 5 tons hooked up and tried each side of the auldigger. about 30 minuts. It was ok. (finished)	pass,
29.09.2024	(A 400 winch brake and winch function test run with load) - Test the winch function without no load. 5 tons of load and tried the winch brake. It was ok. (finished)	*
30.09.2024	(A 400 boom holding valve and telescope holding valve test run with load) - We tested the boom and telescope function with 5 ton about 1 hour. It was ok (finished)	* .

Already finished with estimated agreement lead time with PTT.

Date	Activities	Remark
10.2024	- Join the close meeting with PTTEP team.	✓
2.10.2024	- Go back Yangon.	✓

2024

Taxi (Bus, Motorcycle, 3-wheel etc...) Charges Form

Date	Holding Business	Department	Name	Rental Purpose	Departure Time	Start Location	End Location	Claim Amount	Allowed Amount	State	Remark
24-09-10	Concrete Equipment	Service	Nyi Min Khant(2)	Go to Mingarlardon Air Port for Dawei Customer PTTEP Dawei Service job at 4:00 AM	04:00	Hlaingtharyar	Mingarlardon Air Port	20,000	18,000	GA Manager Approved	
24-09-10	Concrete Equipment	Service	Hein Thiha Soe(1)	Go to Mingarlardon Air Port for Dawei Customer PTTEP Dawei Service job at 4:00 AM	04:00	Kyimyindaing	Mingarlardon Air Port	23,000	20,000	GA Manager Approved	
24-10-02	Concrete Equipment	Service	Nyi Min Khant(2)	Go Back from Dawei Trip Service job site (Customer PTTEP at 8:00 PM	08:00	Mingarlardon Air Port	Hlaingtharyar	20,000	18,000	GA Manager Approved	
24-10-02	Concrete Equipment	Service	Hein Thiha Soe(1)	Go Back from Dawei Trip Service job site (Customer PTTEP at 8:00 PM	08:00	Mingarlardon Air Port	Kyimyindaing	23,000	20,000	GA Manager Approved	

အချက်အလက်စာရွက်

ဤစာရွက်ကို အသုံးပြုရန် အောက်ဖော်ပြပါ အချက်အလက်များကို ဖြည့်စွက်ရမည်။
ပုံစံ/ခ)၊ နတ်မောက်လမ်း။ (၁၀)ရပ်ကွက်၊ လှိုင်သာယာမြို့နယ်။
ဖုန်း - ၀၉ ၅၅၃၅၀၃၀၀၀၀၊ ၀၉ ၇၅၅၃၂၆၇၀၆

စုစုပေါင်း ၅ ၂၅ ၂၁၇

အမျိုးအမည်	ဦးရေ	နှုန်း	ကျသင့်ငွေ
ပိတ်တောက်	၆	၁၀၀၀	၆၀၀၀
PTTEP			

Standard Tools Box (total)

Item No	Description	Quantity	Unit	Remarks
1				
2				
3				
4				
5				
6				
7				
8				
9				
10				
11				
12				
13				
14				
15				
16				
17				
18				
19				
20				
21				
22				
23				
24				
25				
26				
27				
28				
29				
30				

၂၀၂၀ ခုနှစ် ဇူလိုင်လ (၇) ရက်နေ့
 ဝန်ထမ်းများ၏ အလုပ်အကိုင် အခြေအနေအထား
 စစ်ဆေးရန် အတွက် အောက်ဖော်ပြပါ အချက်အလက်များ
 ကို စစ်ဆေးရန် အတွက် အောက်ဖော်ပြပါ အချက်အလက်များ
 ကို စစ်ဆေးရန် အတွက် အောက်ဖော်ပြပါ အချက်အလက်များ

အမှတ်	အမည်	အသက်	အခြား
၁	မောင်	၆	၆၀၀၀
၂			
၃			
၄			
၅			
၆			
၇			
၈			
၉			
၁၀			
၁၁			
၁၂			
၁၃			
၁၄			
၁၅			
၁၆			
၁၇			
၁၈			
၁၉			
၂၀			

PTTEP



REDMI 10 5G | MR.H

09/09/2024 21:18



REDMI 10 5G | MR.H

11/09/2024 12:58

အခွင့်ကျန်းမာ စိတ်ချမ်းသာ ကျေးဇူးတင်အတွက်ပါ

our health, for your wealth

hot line: 09 88 33 49 498, 09 88 33 49 499



INVOICE


Consheld (SII) 2 pax x 25000 = 50000

500081

Paid

Dr. Thant Zin
M.B.,B.S(Ygn)
SAMA-19592

 email: acanclinic@gmail.com

 22(A), Thiri Mingalar (Japan) Street,
Ywar Ma (East) Qtr., Insein Township, Yangon





COVID-19 VACCINATION RECORD CARD

Name HEIN THIHA SOE Gender..... M DOB..... 15 AUG 1993
 NRC No 10/ KAHTANA (N) 119046 Passport No -
 Address BUILDING 10, ROOM 29, PAN HLAING HOUSING, KYIMYINDAING TSP, YANGON

Vaccination	Product name (or) Manufacturer/ Lot Number	Date	Signature of Healthcare Provider
3 rd Dose (Booster)	COVISHIELD (SII) BNo. 4122MC168	15 FEB 2023	
(Primary series were vaccinated in other healthcare center)			Dr. Thant Zin M.B.,B.S(Ygn) SAMA-19592



** Please keep this record card which includes medical information about the vaccines you have received.



COVID-19 VACCINATION RECORD CARD

Name NYI MIN KHANT Gender..... M DOB..... 19 JUN 1999
 NRC No 5/ TASANA (N) 164435 Passport No -
 Address MYEIK, KANGYI QUARTER

Vaccination	Product name (or) Manufacturer/ Lot Number	Date	Signature of Healthcare Provider
3 rd Dose (Booster)	COVISHIELD (SII) BNo. 4122MC168	15 FEB 2023	
(Primary series were vaccinated in other healthcare center)			Dr. Thant Zin M.B.,B.S(Ygn) SAMA-19592



** Please keep this record card which includes medical information about the vaccines you have received.

စွဲစိစော (၁)

အမှတ် ၄၆၊ ဘက်စုံပစ္စည်းတိုက်ရိုက်ရောင်းချရေး

အမှတ် ၄၆၊ ဘက်စုံပစ္စည်းတိုက်ရိုက်ရောင်းချရေး၊ ဘက်စုံပစ္စည်းတိုက်ရိုက်ရောင်းချရေး
 ☎ ၀၉-၇၇၅၅၂၂၇၉၅, ၀၉-၄၅၄၄၅၅၅၅

၀၉/၀၉/၂၀၂၃

စွဲစိစော	ပမာဏ	ယူနစ်	တန်ဖိုး
၀၀၀၀၀၀ Paper	၇	ပလပ်	၆၀၅၀၀
၀၀၀၀၀၀	၇		၃၇၀၀
၀၀၀၀၀၀	၇		၃၀၀၀
၀၀၀၀၀၀	၇		၆၀၀၀
၀၀၀၀၀၀	၁		၅၀၀
၀၀၀၀၀၀	၁		၃၅၀၀
၀၀၀၀၀၀	၇		၆၀၀၀၀
၀၀၀.၃	၃		၆၀၀၀
၀၀၀.၅	၃		၆၄၀၀
			<hr/>
			၃၃၆၀၀
၀၀၀၀	၇		၆၀၀

စုစုပေါင်း ၆၃၉၂

.....



CE3+CNC Service Team

13 members



Pinned Message

Dear all Service Team, ကနေ့ကစပြီး ခွင့်ယူမယ်ဆိုရင်...




Htet Myint Myat Aung
ME210 Serial number 0000678
job ဖွင့်ပေးပါဦး



11:24 AM

Thet Phyo Aung

✓ Done par 11:33 AM

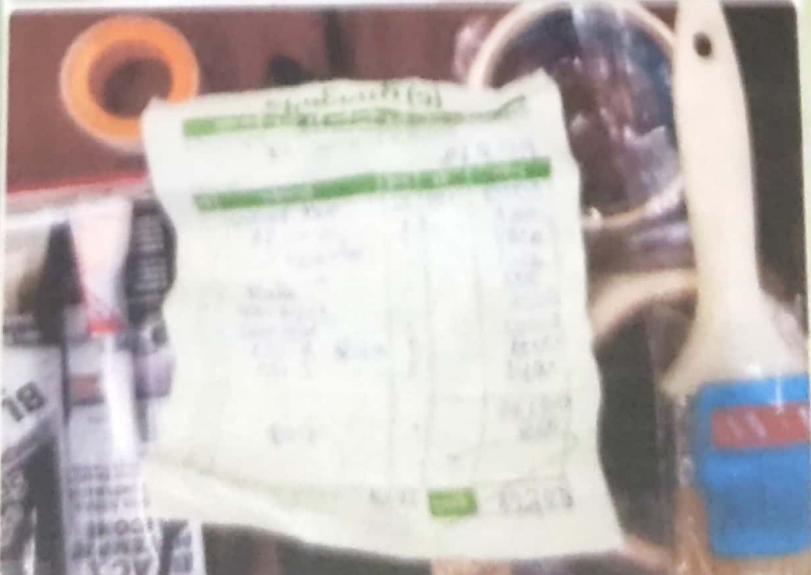

+95 9451564255
Not seen recently

ADD WIN ZAR TO CONTACTS X

Dear MD,

(၀) အမည်- Hein Thiha Soe, Nyi Min Khan


ရာထူး - DH , Mechanic
ဌာန - CE3+CNC BU

(၂) သွားရောက်သည့် ဝန်ထမ်း အရေအတွက် - 2 ယောက်

(၃) ခရီးသွားသည့်နေရာ - Dawei, Kan Pauk, Customer (PTTEP)

(၄) ခရီးသွားသည့် အကြောင်းအရာ - Heavy Vehicle PM Service Crane (2units) Repair Jobs

(၅) စတင်သွားရောက်မည့် နေ့ရက် -

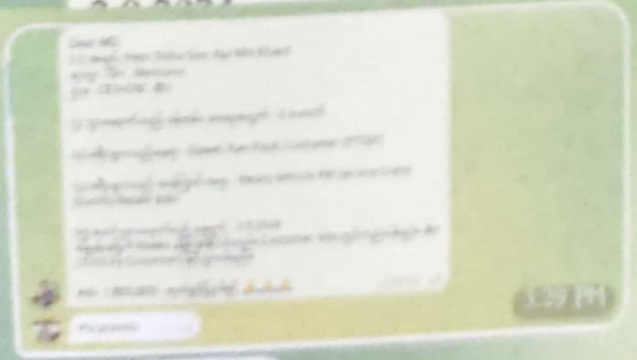

Ald Naw 3:28 PM

Message

9:14 AM

CE3+CNC BU & Aftersale: 34 members

Dear Aung Hein Win ,Ko Aung Hein Win

Dawei, Kan Pauk သို့ Job သွားခိုက် ခြံ့ထု အတွက် Approved စေးစေးဝေးဝေးပါအုံးရှင်

၀)ဝန်ထမ်းအမည် - Hein Thiha Soe, Nyi Min Khan.

ရာထူး- DH,Mechanic
ဌာန - CE3+CNC BU

၂)သွားရောက်မည့်ဝန်ထမ်းအရေအတွက်- (2) person

၃)ခရီးသွားမည့်နေရာ - ထားဝယ်မြို့
၄)ခရီးသွားမည့်အကြောင်းအရာ - 5 Yearly Maintenance for CRANE

၅)ခရီးစတင်သွားရောက်မည့်နေ့ရက် (10.09.2024) နှင့် ပြန်ရောက်မည့်နေ့ရက် (10.10.2024) ခန့်မှန်းပါရှင်
၆) Transportation - Air Ticket (Cost By Customer)

Customer - PTTEP
Model - TADANO Crane

Aung Hein Win

Thiri Mon
Dear Aung Hein Win ,Ko Aung He...
Please proceed

Aung Hein Win
Please proceed

ထုတ် ချော့ပေးပါအင်္ဂါ

Message